

10.1" 12G-SDI Field Monitor



User Manual

Foreword

Thank you for purchasing our 10.1-inch 12G-SDI field monitor. Please read this manual carefully before using the unit. Have a great experience!

Caution

1. Please avoid the heavy impact and drop onto the ground when move the product.
2. The screen of this product is made of glass.Keep away from injury if the screen is broken.
3. Keep the product away from the heat source, and avoid the prolonged exposures to the sun as the LCD screen will be damaged.
4. Please do NOT use chemical solutions to clean this product.
Please wipe the monitor with a clean soft cloth to maintain the brightness of the surface.
5. No adjustable components are in the monitor. Please do not take apart or repair the unit by yourself, to avoid the damage of the product.

Key Features

- 10.1-inch 1920x1200 full HD IPS screen
- Touch screen menu operation, improve shooting efficiency
- 1200nits daylight viewable
- Rugged aluminium housing
- 12G-SDI input and output, meet more professional production
- With SDI & HDMI cross conversion
- Support HDR monitoring, what you see is what you get
- Load custom 3D-LUT, preview film look


- CalMAN Factory Calibration for Accurate Color Reproduction
- Custom LUT Calibration for Consistent On-Set and Post-Production Color
- 3G-SDI & HDMI support LUT loop out
- With Waveform, Vector scope, Histogram, Focus Assist, Monochrome etc. functions, can help you accurately exposure and focus every shot.
- Under HDMI signal the audio meter level can be display max 8 channels; under SDI signal can be display max.16 channels
- Tally Indicator, enhance team cooperation
- Stereo Earphone output
- Standard accessory dual NP-F battery plates, long-lasting power for outdoor filming

CONTENTS

1. Product Description	4
1.1 Structure Instruction	4
1.2 Power Supply Ways	5
1.3 Battery Plate Mount Steps	5
1.4 Mount Points	6
1.5 TALLY Indicator Connection	6
2. Menu Operation Instruction	7
2.1 Touch Screen Menu Operation	7
2.2 MENU Wheel Menu Operation	8
2.3 MENU UI Instruction	9
2.4 Cross Conversion Instruction	10
3. Menu Function Instruction	10
4. How to Load LUT	18
5. Custom LUT Calibration Instruction	19
6. Support Formats	20
7. Technical Parameters	21
8. Trouble Shooting	22

1. Product Description

1.1 Structure Instruction

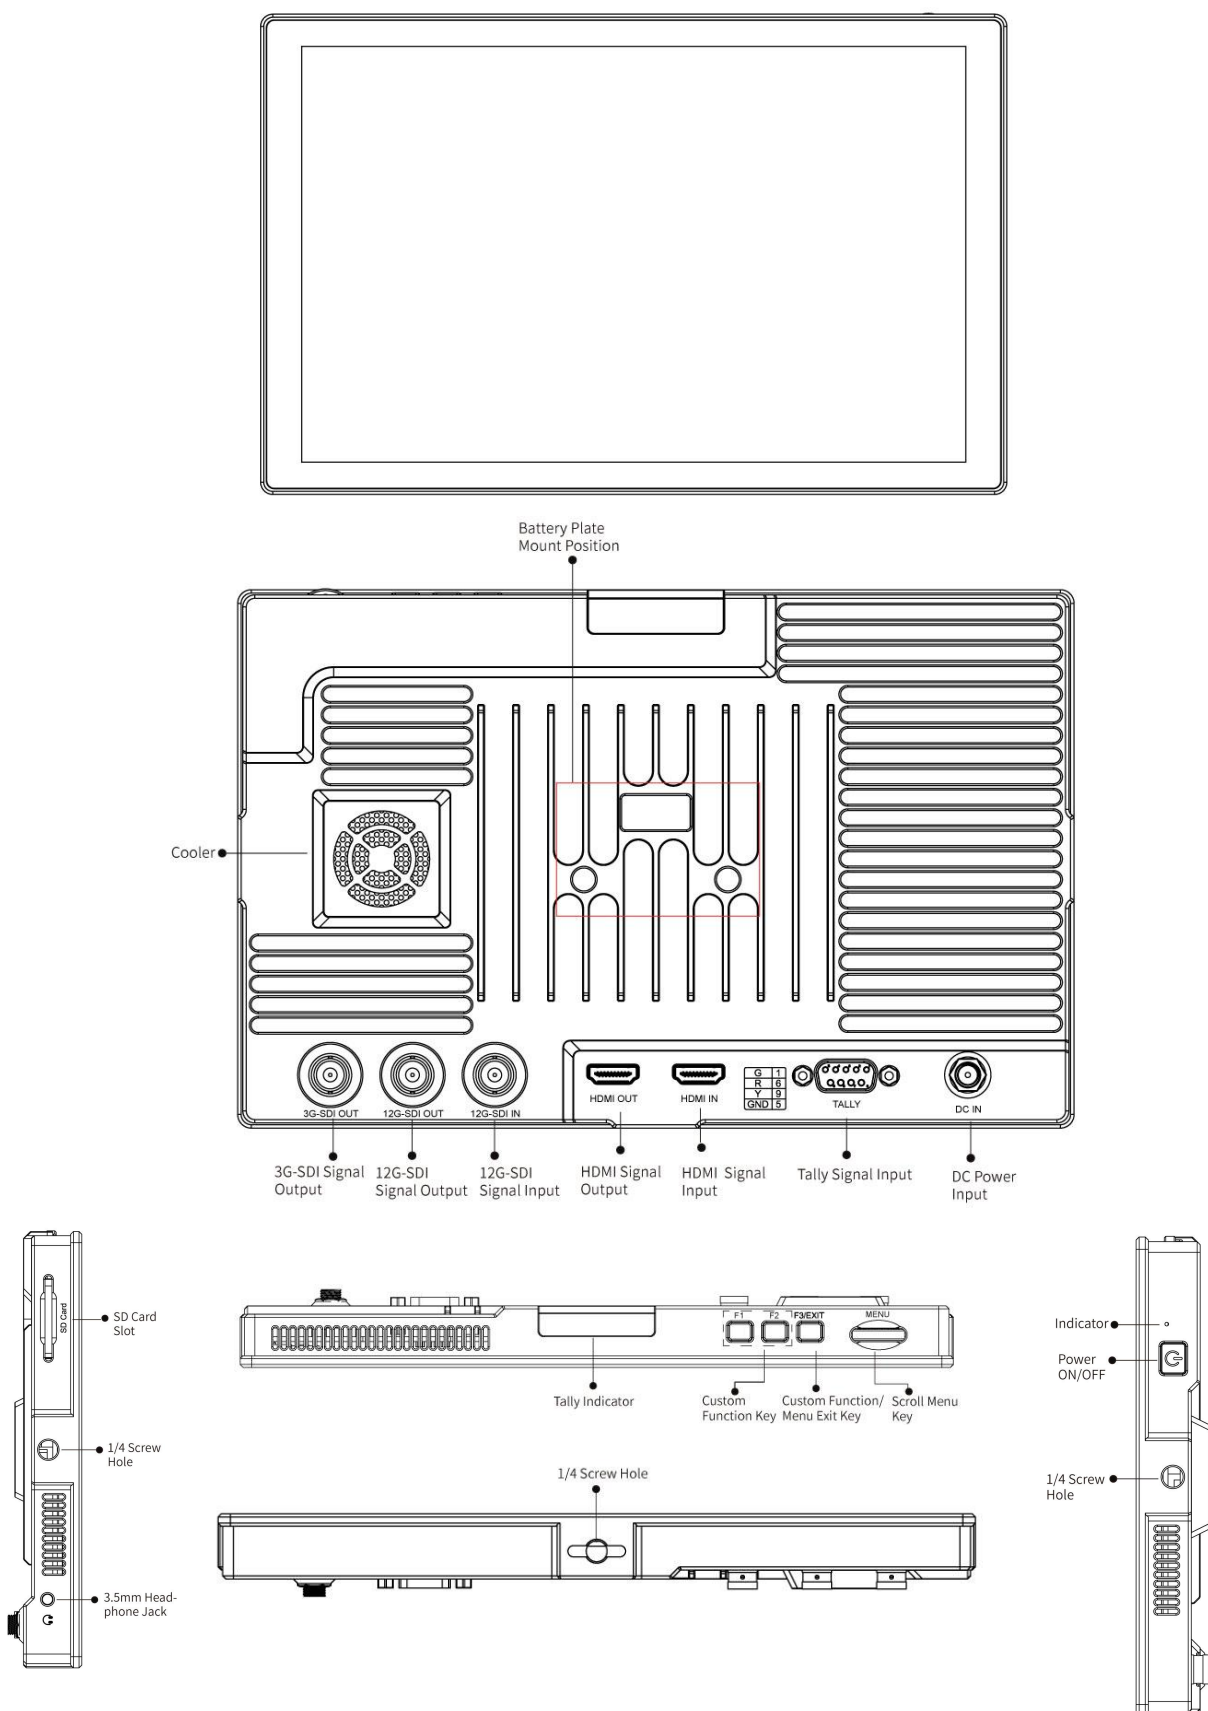

1.2 Power Supply Ways

- (1) The rear cover of the monitor is equipped with a dual F970 battery plate, which is applicable to F970 series of batteries. The battery level will be showed on the right upper corner of the monitor after the battery installation. The user also can select V-mount battery plate for option.

Sony F970 battery plate for battery of Sony DV:

Sony F970 F960 F950 F930 F770 F750 F730 F570 F550 F530 series

Remark: It is recommended to use standard original F970 batteries.


Different specifications of the battery have different capability. The working time for the monitor will be different. Higher capability (working time) will be longer. Please take off the battery from the monitor if you don't use the monitor in a long time.

- ❖ **Battery Switching Instruction:** When install two batteries at the same time, both battery level will be showed on the right upper corner of the monitor. Users can click on another battery to switch when one battery is running low, the white indicating working battery and the gray indicating non-working battery.

- (2) **DC IN 12V:** DC power input, polarity as the input power , Barrel (5.5mm outer, 2.1mm inner) at the bottom of the monitor, DC 7~24V Input. Suitable use for 12V/3A power adapter.

1.3 Battery Plate Mount Steps

- (1) Install the 2P power cable to the cutout
(2) Align the screws with the screw holes and tighten them

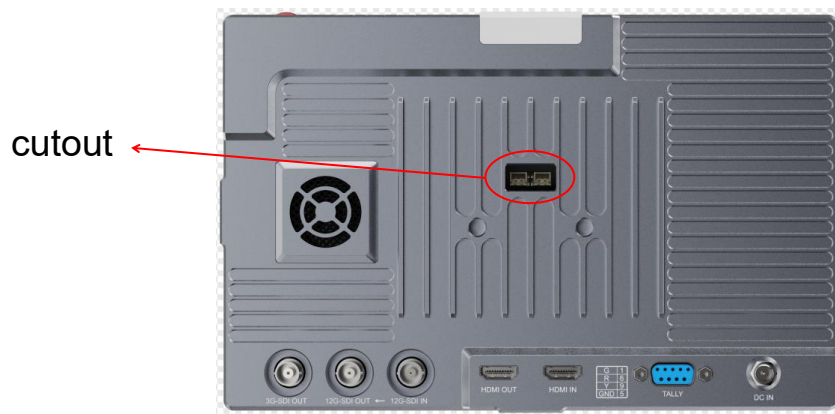

❖ Picture after battery plate installation




Dual F970 Battery Plate(standard)




V-mount Battery Plate(optional)

1.4 Mount Points

There are (3) $\frac{1}{4}$ -20 thread points (bottom, right, left) can be easily connected to the hot shoe mount, tripod fixed installation.

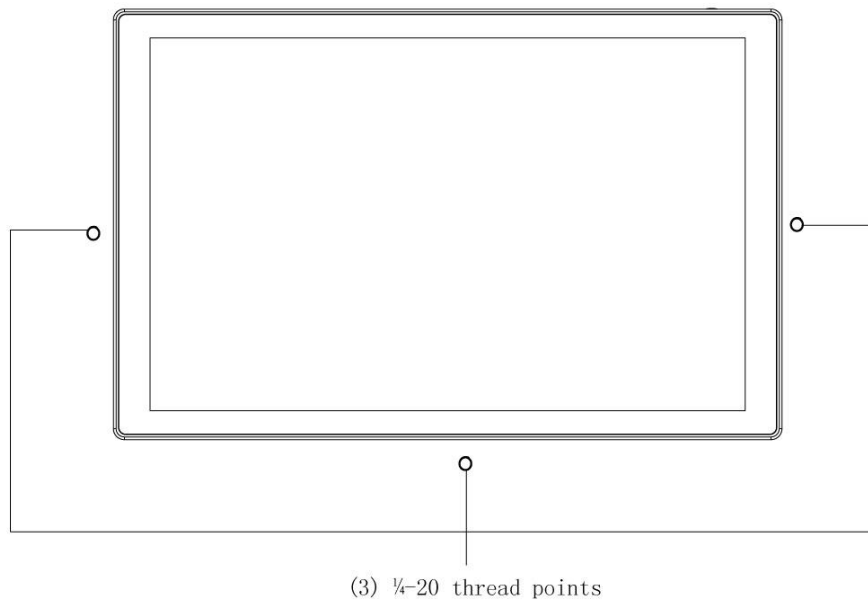

1.5 TALLY Indicator Connection

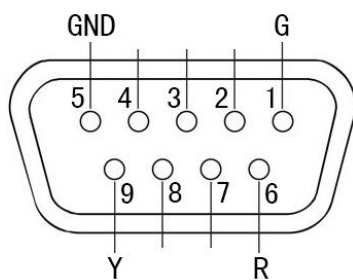

Indicator Color	Pin connect
Green	1-5
Red	6-5
Yellow	9-5

2. Menu Operation Instruction


After the monitor is properly connected to the power supply, the indicator display (red). The monitor defaults to turn on automatically. After the signal is connected, the indicator turns green.

When you press  button to turn off the monitor but the power is still connected, you need to press  button to turn on again.

2.1 Touch Screen Menu Operation (turn on the screen touch function)

- ①. The touch function can be set as a shortcut key via **Menu - -User Option - -Shortcut Key - -F1, F2 or F3- -Touch Switch**. When the menu is not displayed, you can press it directly turn on or off the touch function. For example, you set it as F1, please press F1
- ②. Double-click on the screen to open the main menu (show on the left side of the screen) and click on the corresponding menu to display the secondary menu. You can enter the corresponding function option and click directly to select or set. Click the touch screen to exit the menu.
- ③. When the menu is not displayed, swipe up from the bottom of the screen to open the shortcut menu, swipe left or right select the needed function and click on the corresponding menu box to turn on or turn off the corresponding function. (remark: the shortcut menu can't set the detail function or parameters, you can set on main menu)
- ④. When the menu is not displayed, on the left side of the screen (1/2 split screen), you can directly adjust the brightness of the screen backlight; on the right side of the screen (1/2 split screen), you can directly adjust the volume.


Figure:

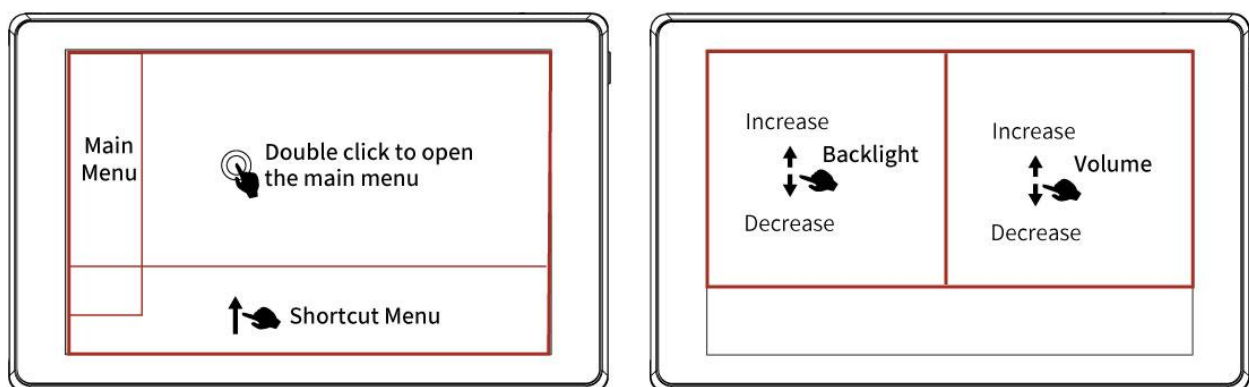

2.2 MENU Wheel Menu Operation

- ①. When the menu is not displayed, directly rotate the wheel to backlight or volume adjustment. The wheel option can be set to backlight or volume via menu --left right key
- ②. Short press the MENU wheel to open the main menu (on the left side of the screen), rotate the wheel to select menu. After selected, press the wheel to show the secondary menu, then rotate the wheel to select. After selected, press the wheel to enter function menu, rotate the wheel to select or set option function, press the wheel to confirm after selected or set, then the icon will show gray.
- ③. Long press the MENU wheel to open the shortcut menu (below the screen), rotate the wheel to select the shortcut menu option, press the wheel to directly turn on/off the function.
- ④. Press **F3/EXIT** key to return or return the menu

2.3 MENU UI Instruction

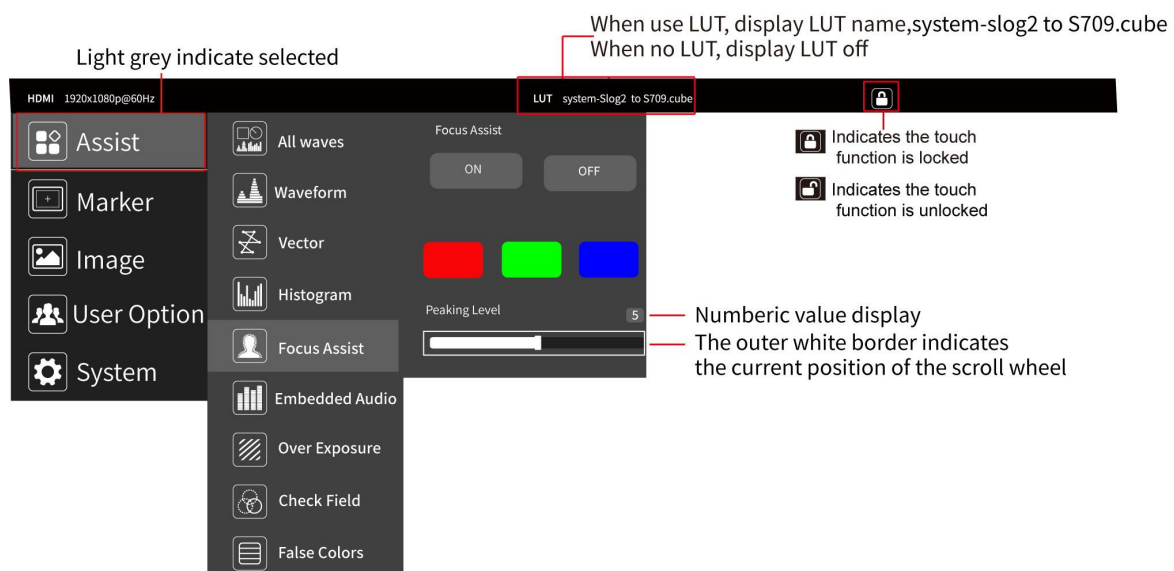

2.4 Cross Conversion Instruction

The monitor supports SDI and HDMI signal cross conversion, the output resolution support max.1920x1080

- HDMI input can output HDMI, 3G-SDI simultaneously
- 12G-SDI input can output HDMI, 3G-SDI ,12G-SDI simultaneously

Note: ① when use the cross conversion function, the HDMI output need to set as **Display** (enter main menu **System--Source--HDMI OUT--Display**)
 ② the support format of 12G-SDI output always same as 12G-SDI input

3. Menu Function Instruction



Assist

 All Waves	ON, OFF After turning on, waveform, vector, histogram and embedded audio will be shown.
 Waveform	ON, OFF Mode: RGB, YUV, Y Waves Trans.:Off, 25%,50%,75% Position X: 0~100 (moving the waveform horizontally) Position Y: 0~100 (moving the waveform vertically) This essential feature assists with the calibration of professional video cameras. It shows the overall brightness of the image assisting the video professional in correcting exposure. The waveform feature also checks the evenness of the lighting when lighting a chromakey or background.
 Vector	ON, OFF Position X: 0~100 (moving the Vector horizontally) Position Y: 0~100 (moving the Vector vertically) Shows how saturated the image is and where the pixels in the

	image land on the color spectrum.
 Histogram	ON, OFF Mode: RGB1, RGB2, Y Position X: 0~100 (moving the histogram horizontally) Position Y: 0~100 (moving the histogram vertically) Y Histogram A quantitative tool to check the picture brightness, display different color for different brightness RGB Histogram It can display the graphic of color tone distribution, can intuitively display the exposure status of the image, and display overlapping histograms in red, green, and blue channels
 Focus Assist	ON, OFF Color: Red, Green, Blue Peaking Level: 1~10 After turned on, the Focus Level (1 ~ 10) and Focus Color can be adjusted. It highlights the areas that are in focus so you are able to quickly focus the camera and not miss crucial shots.
 Embedded Audio	ON, OFF Display an audio diagram after enabled to help you understand the audio status being used. Under HDMI Signal, max display 8 channels Mode: pr1, gp1, gp2, gp12 Audio Out: ch1-2, ch3-4, ch5-6, ch7-8 pr1 display1-2 channel, gp1 display 1-4 channel, gp2 display 5-8 channel, gp12 display 1-8 channel Under SDI Signal, max display 16 channels Mode: pr1, gp1, gp2, gp12, gp3, gp4, gp14 Audio Out: ch1-2, ch3-4, ch5-6, ch7-8, ch9-10, ch11-12, ch13-14, ch15-16 pr1 display1-2 channel, gp1 display 1-4 channel, gp2 display

	5-8 channel, gp12 display 1-8 channel, gp3 display 9-13 channel, gp4 display 14-16 channel, gp14 display 1-16 channel Display an audio diagram after enabled to help you understand the audio status being used. Position X: 0~100 (moving the audio level horizontally) Position Y: 0~100 (moving the audio level vertically)
 Over Exposure	ON, OFF After the exposure is turned on, the Exposure Level (10RE~100IRE), can be adjusted.
 Check Field	On, Off Mode: red, green, blue, gray When enabled, hue and saturation adjusted quickly and accurately.
 False Color	ON, OFF Mode: Normal, ARRI An image that depicts an object in colors that differ from those a photograph (a true color image) would show.



Marker

 Grids	ON, OFF Mode: 2x2, 3x3, 4x4, 5x5, 6x6, 7x7, 8x8, 9x9, Custom Rows: 2~9 Columns: 2~9 When selecting Custom, you can custom the rows and columns of the grid Color: Red, Green, Blue, Black, White, Gray
---	--

	The area of the picture can be divided into 4 ,9, 16, 25, 36, 49,64,81 equal grids or custom the grid.
 Safe Frames	OFF, ON Mode: 80%, 85%, 90%, 93%, 96%, 2.35:1 Marker Line Color: Red, Green, Blue, Black, White, Gray
 Center Marker	ON, OFF Marker Line Color: Red, Green, Blue, Black, White, Gray
 Ratio Marker	ON, OFF Mode: 4:3, 13:9, 14:9, 15:9, 16:9, 1.85:1, 2.35:1 Marker Line Color: Red, Green, Blue, Black, White, Gray Modified Mark: 0~5



Image

 Scan Mode	Under Scan, Over Scan
 Aspect Ratio	Auto, 16:9, 16:10, 4:3, 5:4, 1.85:1, 2.35:1, Full Screen
 Anamorphic	ON, OFF Mode: 1.33x, 1.6x, 2.0x, 2.0x mag, User Under User, you can custom adjust nx (1.20x~2.00x) Allows you to use anamorphic lenses or adapters and see the image unsqueezed, even if your camera does not de-squeeze in camera.
 Image Flip	ON, OFF Mode: H Flip, V Flip, H_V Flip

 Zoom Mode	ON, OFF Mode: 2X, 4X, 9X, 16X, User Under User, you can adjust 100%~200% It is HD signal in any part, an amplification for high quality close-up.
 Image Freeze	ON, OFF
 P2P (Pixel to Pixel)	ON, OFF Enable the filmmaker to check the image from the 1:1 signal source without scaling. This feature is essential for capturing optimum detail.



User Option

 LUT	ON, OFF LUT is a table for quickly looking up and output specific color data. By loading different 3D-LUT tables, it can quickly recombine color tone to form different color styles. LUT Import: Confirm LUT Table: display built-in SLOG2, SLOG3, LOGC, VLOG and the custom LUTs
 HDR	HDR: ON, OFF Mode: HLG1, HLG2, HLG3 HDR can provide more dynamic range and the details of image, it is better to reflect the visual effects in the real environment.
	Backlight: 0~100 Adjust the screen brightness

Display Adjustment	Brightness: 0~100 Adjust the image brightness Contrast: 0~100 Adjustment of the ratio between the brightest and darkest parts of the image . When adjusting, pay attention to the sense of hierarchy in the image. If the proportion is too large or too small, it can cause the image to lose its colorful appearance. Saturation: 0~100 Adjustment of color concentration Tint: 0~100 It is the most accurate standard for distinguishing various different colors. Determine what a certain color is actually color via the color appearance.
 Color Adjustment	Color Gamut: DCI-P3, REC709 Display Range: Auto, Limit, Full This feature allows for the selection of a grayscale range. The Limited grayscale range is 16-235, and the Full grayscale range is 0-255. (Grayscale represents changes in image brightness, using varying gray levels to depict brightness in different image areas. In grayscale, brightness increases from black to white, typically denoted by a numerical range from 0 to 255, where 0 signifies black and 255 indicates white, and intermediate numbers indicate varying grayscale levels.) 1. If the dark part of the picture lost, the details cannot be seen clearly. For example, the input signal is in the range of 0-255, but the monitor is set Auto or Limit, the brightness of 0-15 and 236-255 is removed, resulting the dark part details unclear. You can set to Full.

	2. If the picture is gray, the black part turned gray. For example, the input signal is in the range of 16-235, but the monitor is set Full , resulting the black part turn gray. At this time,you can set to Auto or Limit. Color Temp.: 5600K, 6500K, 9300K, User Under the “user”, the red, green, and blue values of the image can be adjusted (0~255)
 Shortcut Key	F1~F3 Shortcut List: All Waves, Waveform Vector, Histogram, Embedded Audio, Center Marker, Safe Frames,Grids, Focus Assist, False Colors , Over Exposure, Anamorphic, Image Freeze, Check Field, Zoom Mode, Image Flip, Aspect Ratio, Touch Switch Set the shortcut function e.g.: Tap the Shortcut Key in User Option, and select F1 Function, then select one of function on Shortcut List, such as “Analysis”. So when you exit menu, you could press F1 directly on the front of panel to turn on “Analysis” function. Same setting for F2~F4
 Left Right Key Set	Backlight, Volume



System

 Language	English, 简体中文, Español, Português, Français, Nederlands, Deutsch, 日本語, 繁體中文, 한국어로, русский язык
--	---

 OSD Option	OSD Time: off, 15s, 30s, 45s Select the display time of the menu on the screen OSD Trans: OFF, 25%, 50%, 75% Adjust the transparency of the menu picture background on the screen. No Signal: Red, Green, Blue, Black, White, Gray
 Volume	Mute: ON, OFF Volume: 0~100 Adjusting the speaker volume
 Cooling Fan	ON, OFF Mode:1~5 Note: the fan default to ON and with 3 mode
 Source	Input Source: HDMI, SDI Output Source HDMI OUT: Loop Out, Display When selecting Loop Out , HDMI output supports up to 4K@60Hz; When selecting Display , it defaults to output with LUT effect and supports maximum resolution of 1920x1080. When you need to use cross conversion , please also select Display . 3G-SDI LUT Out: LUT On, LUT Off
 Reset	After confirmed, the system back to original setting.
 Firmware Update	Firmware Version (display the current firmware version) FTY CAL: On, Reset Reset: If you import your own LUT calibration but encounter abnormalities or poor result, you can clear the calibration LUT by clicking "Reset" in FTY CAL and return to the factory calibration. Confirm Each monitor has color calibration before ex-factory, the factory calibration button turn on by default. After turning off, the monitor will without has color calibration, suggest don't

	turn it off. How to upgrade? 1. SD card format Support FAT32 or NTFS. For MAC system, the SD card should be formatted in MS-DOS (FAT) 2. After copying the update file to the SD card and inserting it into the SD card slot, click Confirm to update. 3. The monitor will turn off automatically after finishing, please turn on manually 4. Check the firmware version whether the latest one Note: the chip should be faced up when inserting the SD card, and press it after inserting to ensure that the SD card is fully inserted.
--	--

4. How to Load LUT

4.1 SD card format

Support FAT32 or NTFS. For MAC system, the SD card should be formatted in MS-DOS (FAT)

4.2 Max Files Limit Maximum 32 Lut files

4.3 File requirements

- The LUT file format suffix should be **.cube**
- Single file not exceeded to 7.9Mb
- Support LUT-3D-Size 16,17,32,33,64,65

Remark: LUT file name must be English or Arabic numerals

4.4 Steps for loading

4.4.1 Make sure the SD card correctly insert

4.4.2 Enter main menu **“User Option”--LUT--Lut Import -- Confirm** to load

the monitor will auto detect the SD card

A. There is no SD Card, the screen will show failed,can try once more,if not work, restart the monitor and try again

B. There is SD Card, the monitor will erase the exits user’s lut fill and show “Initializing” , If there is no valid lut file in SD card, the lut will not load.The monitor will show “clean up”

C. If there is valid lut file in SD card, the monitor will load lut files and show “[n] name. The [n] shows the quantity number. The “name” should in lut files’ name. If load successful, the screen will show “complete[n]”. [n] Stands for the quantity number for lut files should under 32.

5. Custom LUT Calibration Instruction

Support professional colorimeters and color management software to generate custom 3D LUT calibration files and import them into the monitor’s internal storage. Through LUT-based color correction, display deviations can be effectively corrected for more accurate color reproduction, helping maintain consistent color standards from on-set monitoring to post-production.

Compatible with professional calibration devices and 3D LUT generation tools, including color analyzers such as CA-210 and CR-100, as well as professional color management software such as ColourSpace CMS and CalMAN Studio.

5.1 Calibration Preparation

- Reset the monitor to factory settings (enter menu--System--Reset)
- Turn off FTY CAL (enter menu--System--Firmware Update--FTY CAL--OFF)
- Set Display Range to Full (enter menu--User Option--Color Adjustment--Display Range--Full)

5.2 SD card format

Support FAT32 or NTFS. For MAC system, the SD card should be formatted in MS-DOS(FAT)

5.3 File requirements

- The LUT file format suffix should be **.cube**
- Single file not exceeded to 7.9Mb
- Support LUT-3D-Size 16,17,32,33,64,65
- For P3 color calibration, file name should be **@User_P3xxxx.cube**, the red font can't be changed, the xxxx can be custom. For example, @User_P3_123456789.cube
- For 709 color calibration, file name should be **@User_709xxxx.cube**, the red font can't be changed, the xxxx can be custom. For example, @User_709_abcdefg.cube.


5.4 Steps for loading

5.4.1 Make sure the SD card correctly insert

5.4.2 Enter main menu “**User Option**”--**LUT**--**Lut Import** -- **Confirm** to load

the monitor will auto detect the SD card

5.4.3 After loading, the file will show like below

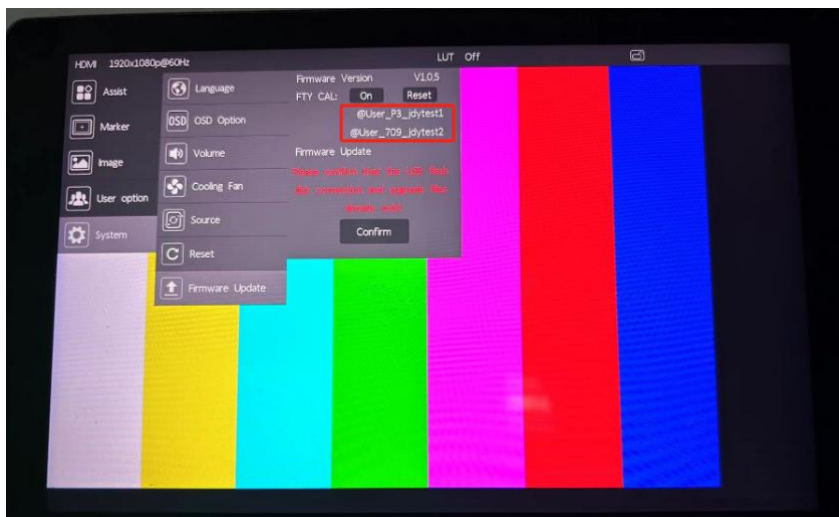

5.5 If you import your own LUT calibration but encounter abnormalities or poor result, you can clear the calibration LUT by clicking "Reset" in FTY CAL and return to the factory calibration.

6. Support Formats

12G-SDI Input & Output Support Format	1080i (60/59.94/50) 720p (60/59.94/50/30/29.97/25/24/23.98) 1080p(60/59.94/50/30/29.97/25/24/24sF/23.98/23.98sF) 2048×1080(30p/30PsF/29.97p/29.97PsF/25p/25PsF/24p/24PsF/23.98p/23.98PsF) 4K 3840×2160p (60/59.94/50/48/47.95/30/29.97/25/24/23.98) 4K 4096×2160p (60/59.94/50/48/47.95/30/29.97/25/24/23.98)
3G-SDI Output Support Format	720p (60/59.94/50/30/29.97/25/24/23.98) 1080i (60/59.94/50) 1080p(60/59.94/50/30/29.97/25/24/24sF/23.98/23.98sF)
HDMI Input Support Format	1080i (60/59.94/50) 720p (60/59.94/50/30/29.97/25/24/23.98) 1080p(60/59.94/50/30/29.97/25/24/24sF/23.98/23.98sF) 4K 3840×2160p (60/50/30/29.97/25/24/23.98) 4K 4096×2160p (60/50/30/29.97/25/24/23.98)
HDMI Output Support Format	When set Display 1080i (60/59.94/50) 720p (60/59.94/50/30/29.97/25/24/23.98) 1080p(60/59.94/50/30/29.97/25/24/24sF/23.98/23.98sF) When set Loop out (without set it will default to Loop out) 1080i (60/59.94/50) 720p (60/59.94/50/30/29.97/25/24/23.98) 1080p(60/59.94/50/30/29.97/25/24/24sF/23.98/23.98sF) 4K 3840×2160p (60/50/30/29.97/25/24/23.98) 4K 4096×2160p (60/50/30/29.97/25/24/23.98)

7. Technical Parameters

Panel Size	10.1" touch screen
Resolution	1920 × 1200 pixels
Dot Pitch	0.1128(H) x 0.1128 (V) mm

Color Display	1.07B
Color Depth	10bit (8+2bit)
Color Gamut	95% DCI-P3, 98% REC709
Aspect Ratio	16:10
Brightness	1200cd/m ²
Contrast	1500:1
Response Time	25ms
Viewing Angle	80°/80°(L/R) 80°/80°(U/D)
Backlight	LED
Backlight Adjustment Mode	Manual
Input	12G-SDI, HDMI, Tally
Output	12G-SDI, 3G-SDI, HDMI
Audio	3.5mm Stereo Headphone
Power Input Voltage	7~24V
Power Consumption	≦25W
Unit Size	244x157.25x26.4 (mm)
Unit Weight	795g
Mount Points	(3) ¼-20 thread points (right, left, bottom)
Working Temperature	-10℃~60℃
Storage Temperature	-30℃~70℃

8. Trouble Shooting

8.1 Only black and white or monochrome picture:

- ① please check saturation, brightness & contrast adjustment.
- ② Please check "Monochrome" is in black, white or monochrome image or other condition.

8.2 NO Image after put on the power

- ① Check if signal cable connecting is in good condition.
- ② Check signal cable connecting, and make sure to use the standard adapter to connect the monitor. If power is supplied by battery, please check if the battery is fully charged.

8.3 Earphone No sound

① Check if Volume control do not open, press the volume button, and try to increase the volume.

■ If there are still other problems, please contact with our related technologists.

★ As we are improving product features and product performance, so if there is any change on the specification without prior notice.